



SERVICE BULLETIN

Classification:

EL96-012

Reference:

NTB96-095

Date:

October 2, 1996

POWER ANTENNA SLEEVE

APPLIED VEHICLE(S): All equipped with power antenna

SERVICE INFORMATION

An antenna sleeve (antenna guide) is available as a separate service part to replace bent or corroded sleeves. A complete listing of available antenna sleeve part numbers is provided on page 2 of this bulletin.

SERVICE PROCEDURE

1. Follow the antenna rod removal procedure outlined in "Audio and Power Antenna" located in the EL section of the appropriate service manual.
2. The antenna sleeve should release from the antenna assembly when the rod is removed. If the antenna sleeve is bound, the rod may not release after the removal of the nut and base. In this case, use pliers to carefully remove the antenna sleeve (with the radio "OFF"). After the antenna sleeve is removed, continue with the procedure to remove and replace the antenna rod.

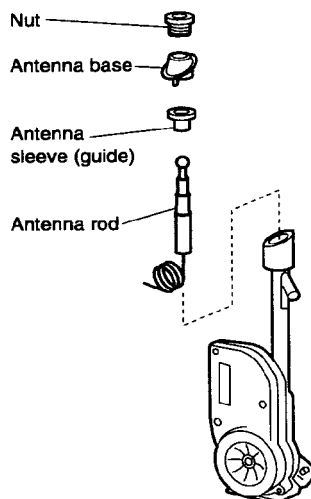


Figure 1

TC960756

PARTS INFORMATION

DESCRIPTION	APPLIED MODELS	MODEL YEAR	PART NUMBER
Antenna sleeve	200SX (S12)	84-88	B8217-10V00
	Maxima (U11)	85-88	
	300ZX (Z31)	84-89	
	Stanza (T12/U12)	87-92	
	Sentra (B13)	91-94	B8217-50Y00
	Sentra/200SX (B14)	95-96	
	Altima (U13)	93-97	
	240SX (S14)	95-96	
	Maxima (A32)	95-97	
	Pathfinder (R50)	96-97	
	Pathfinder (WD21)	87-95	B8217-91L00
	Sentra (B12)	87-90	
	300ZX (Z32)	90-96	
	Maxima (J30)	89-94	
	Axxess (M11)	90	
	240SX (S13/S14)	89-94	

CLAIMS INFORMATION

Submit a Primary Failed Part (PFP) claim using the following coding:

OPERATION	OP CODE	SYM	DIAG	FRT	PFP
RPL antenna mast only	RN29AA	ZE	28	(1)	(2)

NOTES:

1. Reference the "RN" section of the current Nissan "Warranty Flat Rate Information Manual" and select the Flat Rate Time applicable to the vehicle being serviced.
2. Reference the Parts Catalog for the vehicle being serviced and select the antenna mast part number as the PFP.