


Models	BW T-5 280ZX & 300ZX Turbos
Section	Transmission
Classification	TM84-002
Bulletin No.	TS84-013
Date	February 6, 1984

INSPECTING THE TRANSMISSION FLUID LEVEL, BW T-5, 280ZX & 300ZX TURBOS

On the driver's side of the BW T-5 transmission in 280ZX and 300ZX Turbo models, there is a hex bolt above the back-up light switch that is sometimes mistaken for the transmission fluid plug. That hex bolt, however, is the pivot bolt for the fifth-reverse shift lever and, if it is removed, the lever will drop into the transmission. Disassembling the transmission is the only way to retrieve the parts. To inspect the transmission fluid level, remove the upper plug on the passenger side.

BW T-5 (FS5R90A) for turbocharger model

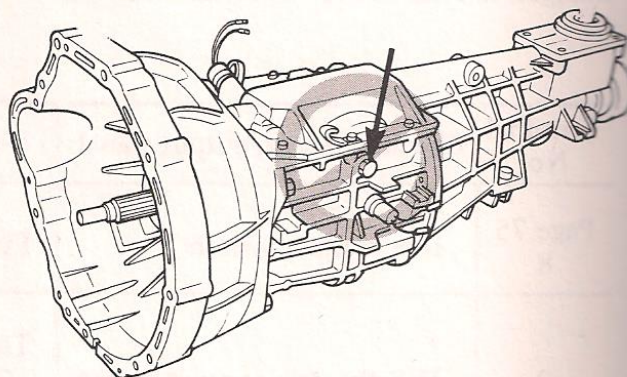

Do not remove the hex bolt above the back-up light switch to check the fluid level.