


Bulletin No.	TS79-022
Date	April 6, 1979
Classification	3E79-003
Section	Body Electrical
Models	280-ZX

BATTERY SENSOR, 280-ZX

Service Information. In 280-ZX models when replacing the original battery with the Prestolite warranty replacement battery (P/N 99996-00034), it will be necessary to install an Electrolyte Level Sensor Kit (P/N 99996-00085) for the computer warning system to function properly. This is the same sensor kit and battery used in 810 models.

If a low maintenance battery (P/N 99996-00026), without openings to add water is installed, it will be necessary to fabricate and install the battery sensor substitute illustrated below for the computer warning system to function properly.

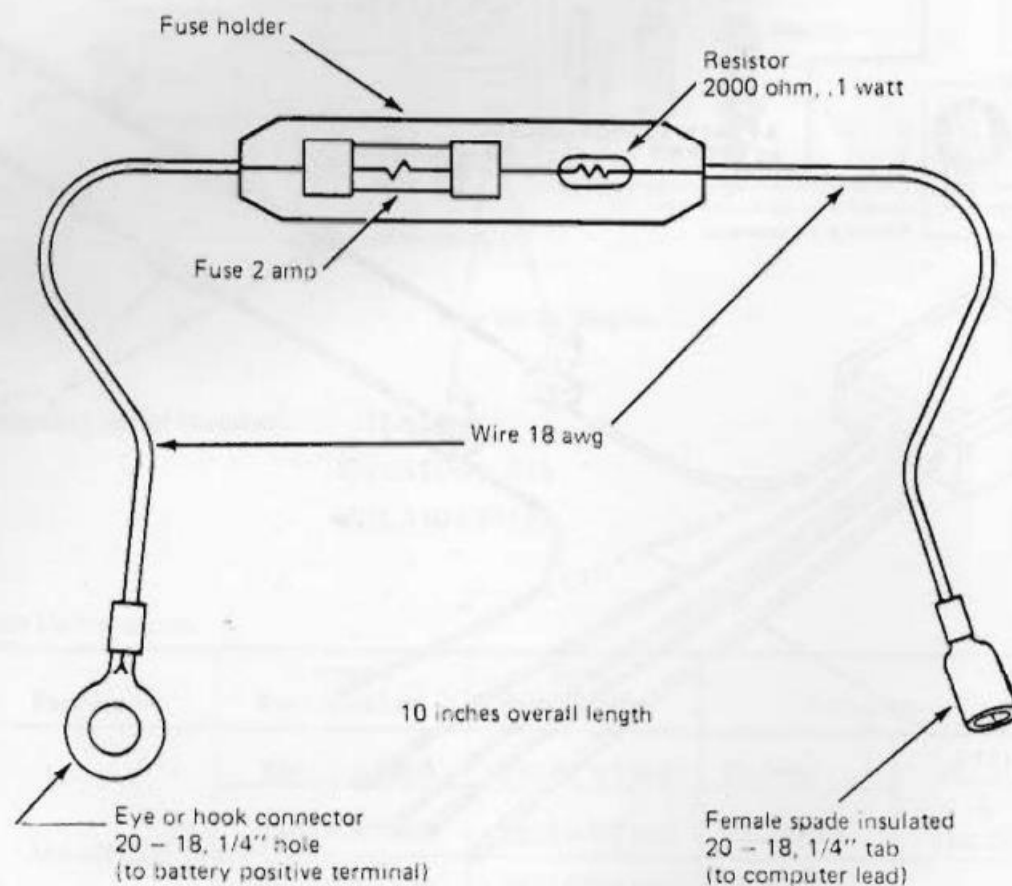

280-ZX Battery Sensor Substitute

(Continued)

Materials (local purchase): Fuse holder
 Fuse, 2 amp
 Resistor, 2000 ohm, 0.1 watt
 Eye connector, 20-18, 1/4"
 1/4" spade connector, female, insulated
 Wire, 10" 18 gauge

Parts Information.

Part Name	Part Number
Electrolyte level sensor kit	99996-00085
Prestolite warranty replacement battery	99996-00034
Low maintenance battery	99996-00026