


Bulletin No.	TS79 034
Date	June 20, 1979
Classification	TM79-003
Section	Transmission
Models	810, S130, 620

## FS5W71B TRANSMISSION


**Production Change.** To improve operation and standardize parts, the reverse main gear and overdrive — reverse hub have been changed.

### 1. Reverse main gear.

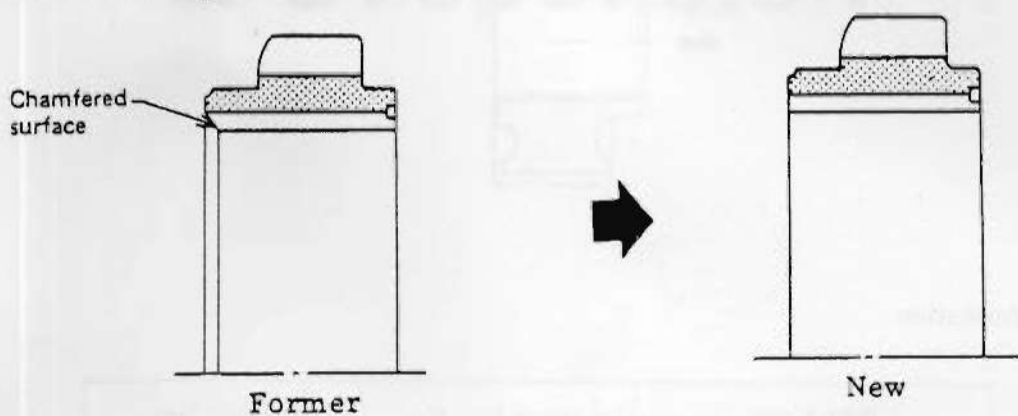

### 2. OD — Reverse synchronizer hub

The hub spline has been redesigned as shown below.

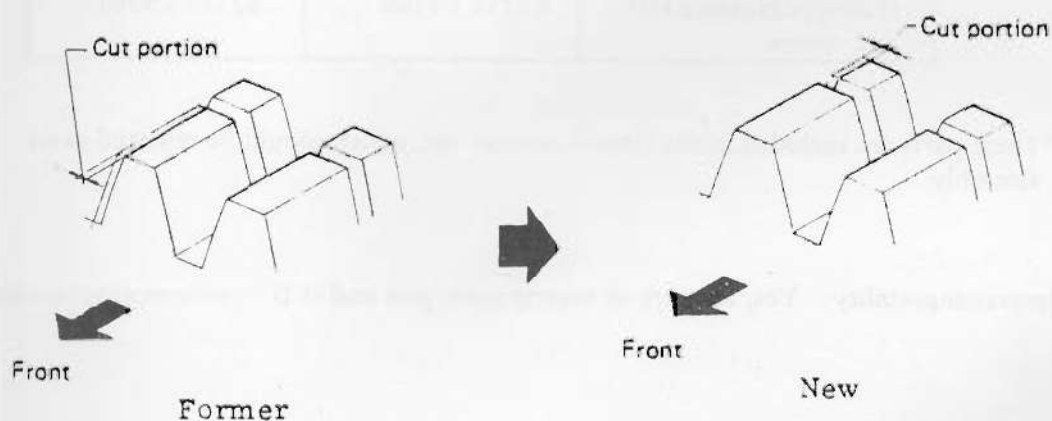


(Continued)

**Beginning Serial Numbers.**

Transmission No. 7816401

Chassis No. (K)HL(G)620-395829

**Service Information.** Note the proper direction for assembling the OD — reverse synchronizer hub illustrated below.

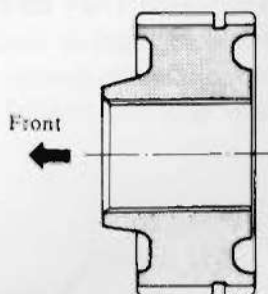

**Parts Information.**

Part Name	Former Part No.	New Part No.
Gear-reverse, set	—	32245 E9525
Gear-reverse, main shaft	32245 E9500	32245 E9501*
Hub-synchronizer OD and reverse	32258 E9500	32258 E9501*

\*These parts are included in the Gear — reverse set, which should be replaced as an assembly.

**Interchangeability:** Yes, as a set of reverse main gear and O D — reverse synchronizer hub.